INTRODUCTION TO CNC ESSENTIALS - 'The Balsa Challenge'

CNC controlled spindles are not difficult to use, but they do require some preparation in advance of using the machine, and they are potentially hazardous. Before we allow anyone to use the machines for themselves, you need to know:

1. What you can and cannot use the machines for, what the main hazards are, and how you can reduce the risk of incidents occurring.

- 2. How to use the Fab Lab CNC Template file.
- 3. What you need in your CAD drawing.
- 4. How to program your files in Rhino CAM ready for cutting.

This knowledge is set out as 4 steps in an online guide below. If you need help please come to the lab between 12 and 1 Monday to Thursday.

STEP 1 WHAT YOU CAN AND CANNOT DO.

What is a CNC spindle and how do we control it?

A Spindle is a very fast spinning motor that holds an END MILL. The end mill spins at a specific SPEED and the machine that the spindle is attached to FEEDS it through the material to cut away the material in its path. This is what is known as the TOOL PATH. The machine that the spindle is attached to is either a MILL or a ROUTER. The machine is controlled by a computer, hence COMPUTER NUMERICAL CODE - CNC. The computer code is generated out of your Rhino CAD file by using a CAM (Computer Aided Manufacturing) plugin call RhinoCAM.

The basics of what a CNC spindle can do and what can it not do.

What it can do.

At a very basic level the End Mill can cut 2 dimensional shapes by using two axis - the X and the Y - it can also create what is called a POCKET by cutting away a set region, part of the way through the material. However, it can also use it's 3rd axis - the Z axis- to cut simultaneously with the X and Y. This enables complex surfaces to be machined. Here in the Fabrication Lab we can cut low and high density foams as well as sheet material such as plywood, MDF and hard plastics like acrylic and also sectional timber.

What it cannot do.

The end mill cannot cut pockets or internal parts smaller than its diameter. The machines are known as 3 axis machines. They can move on the X and Y and up and down on the Z. However, they cannot access undercuts (see the diagram below), this requires a 5 Axis CNC machine. They cannot cut deeper than the specific end mill will allow. Most* of our end mills are designed to cut through 50mm (our thickest stock material).



*There are exceptions, Peter and Bernard will not cut deeper than 40 mm using a 6mm end mill and the 3mm end mill cuts to 10mm in depth.

What CNC Spindles do we have?

We have 7 CNC spindles:

The MILLS (we have 5)

Peter and Bernard are Mills; in fact they are so small we call them mini mills. These are machines that you will complete the CNC essentials on. They can cut low density foam (The black and cream foams) and Balsa wood.

Rem and Bjarke are larger than Peter and Bernard. They also have an automatic tool change so they can swap their end mill automatically based on your file.

The ROUTERS (we have 2)

Renzo and Norman are routers, unlike the mills their bed stays static and the gantry moves. These are designed for large sheet material but can also cut foam and sectional timber. Norman has an automatic tool change, Renzo does not.

What Materials can you use?

This is dependent on the machine and its extraction. The mini mills (Peter, Bernard and Rem and Bjarke) have less power so cannot cut denser materials, they also have no extraction which means they can only cut soft materials like balsa and foam. The routers

(Renzo and Norman) have a lot more power and extraction so they can cut MDF, Ply, harder plastics and foam.

What are the hazards?

The hazards involved with using high speed spindles and moving CNC machines can be

great. The smaller machines are less hazardous as they are enclosed. The larger routers

are extremely powerful and have more hazards with greater consequences.

COLLISION - [HAZARD] As the mini mills are enclosed the risk of collision with yourself and the machine is not possible. This is not the case with Norman and Renzo. [CONTROL]To control this hazard we insist that you observe the machine from outside of the machine room. You must in no circumstances interfere with the machine or the material while the machine is in operation.

FIRE - [HAZARD] As the spindles rotate at an extremely high speed friction is created. If the End Mill is blunt then this friction can be much greater causing the material to ignite. Fire is a very real possibility on the routers. [CONTROL]Therefore when using Norman or Renzo, and observing from outside of the machine room, you must never lose sight of the End Mill.

HARMFUL INHALATION - [HAZARD] The end mills remove material as fine chips this can be a fine inhalable particulate. The mini mills are enclosed and the Routers have high power extraction systems however the particulate can still be made airborne when the material is moved. [CONTROL] Therefore when you have finished cutting be sure to vacuum as much as possible before moving the stock material.

STEP 2: HOW TO USE THE FAB LAB CNC TEMPLATE FILE

The software - Rhino3D

The CNC machine is controlled by a drawing you create in CAD which you then go on to program in Rhino CAM. To start, Download the template file from the link above. Every time you machine a new part download a new template. You can draw your object in any CAD software but you must use RhinoCAM to program it, therefore you must be familiar with RHINO. If you are not do a few tutorials first <u>https://fabricationlab.london/e-learning/lynda/</u> to become familiar with the layout and how to use the layers.

THE TEMPLATE

The Template file is extremely rich and includes a host of information in the 'User Guide' layer. It also represents the sizes of the beds on our different machines and the stock material sizes.

Here are a few golden rules:

- Always work from the latest Template file, which you can download above or in the main CNC page.

- Do not change the file, apart from adding your own drawing into the appropriate layers

- Do your drafting in a separate Rhino file or whatever other software you like, and then copy/import this into the Rhino Template

- If at any time your Rhino file becomes corrupted or confused, just download a fresh, up-to-date copy and start again.

- Once you have completed your Essentials, if you have any questions or want your file checking before using up your booked time, come in advance and ask a Technician or Lab Assistant for help.

How to start:

Expand the first layer called '1. CHOOSE A MACHINE' then 'CNC SPINDLES' and switch the light bulb to activate PETER & BERNARD. The bed size will appear.

Next, expand '2. CHOOSE YOUR STOCK' then 'CNC SPINDLES' expand BALSA and activate the layer called 'Balsa Challenge' using the light bulb. This is the size of your stock material.

Now expand the layer called '3. DRAW YOUR PARTS' - 'CNC SPINDLES'. Below is a screen grab of what you should have.



STEP 3 - WHAT YOU WILL NEED IN YOUR CAD DRAWING

To complete the CNC Essentials, you must produce a part to be cut. This is 'The Balsa Challenge'. This must be a two-part joint cut from two pieces of balsa wood. The stock material is 65mm x 35mm each part can be no bigger than 50mm x 20mm.

In the layers that you place your work you have seen there are 2 axis operations and 3 axis operations. 2 axis operations require curves while the 3 axis operations require surfaces. In the template file under USER GUIDES you will find more information regarding each operation.

What you will need to Prepare for the next step of the CNC Essentials

- 1. A 3D model* of each part of your joint set out in two template files. You might find it easier to draw the joint first in a CAD program of your choice and then import it into the template file.
- 2. At least 2 operations from the 2 axis operations. This could be: Pocketing and Profiling

*Although 2 axis machining only requires curves we do insist you create a 3-dimensional model of your joint



Now you have your all your geometry in the right layers you're ready to use

RhinoCam

STEP 4 - HOW TO PROGRAM YOUR FILES IN RHINO CAM READY FOR CUTTING.

You will need to come to the CAM LAB to program your file. If RhinoCam is not open, in the menu headings at the top select RhinoCAM and choose Mill (even if you are using our Routers Norman and Renzo).

1. The Knowledge Base.

This is a file that loads the particular settings for the stock material you are using. To load the Knowledge Base go to the CNC section of the website and click on 'Download Knowledge Bases' you will be taken to a google drive. For the Essentials right click on 'PETER & BERNARD - BALSA - 4.8mm' and download.

Click on the icon shown in the image below and load the Knowledge Base you just downloaded



Now it has loaded delete the processes you do not need.

2. Setting up the Box Stock

You need to set up the size of the stock material. The template stock material sizes are for you to draw within. They do not inform the machine. Setting the box stock tells RhinoCam the size, thickness and starting origin of your stock.



3. Programing your operations

Double click on the operation. All machining operations require a region to machine. This is your curve. If you have many regions to select, once you have clicked 'select Drive/Containment region', right click on the layer of the operation you need and choose 'Select Objects' then press Enter. Once selected click 'Generate'.



For Pocketing, only - You will need to click on the 'Cut Levels' tab and specify a depth to which the machine will cut (see screen grab below).



4. Check tool paths

Now you have programmed each operation. Check each operation's toolpaths by clicking on each operation and looking at the tool paths in the Top, Front and Perspective viewport to check that they are machining within the material (above 0 and below 4.8mm for Balsa).



5. Time to 'Post'.

To process the CAM file into the G-code that the machine will read you need to 'Post' the file. For Machines that have no automatic tool change (that is Peter and Bernard) you need to Post each process separately. Right click on the Knowledge base operation and click 'Post'. This will create a file called and NC post – save this onto a USB stick.





You are now ready to come to the CNC lab (between 12-and 1pm) with your Rhino files and the nc post you created on a USB stick to have them checked and to book you in to the Practical Part of the CNC essentials.